

# Manhole Inspection Summary

Manhole # S25II2004MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **25II2** Node: **004** Status: **Found**

Insp Date: **3/27/07 10:39 AM**

Incomplete Comments

Crew: **JY, JC, SP, DP**  
Inspector: **Yi, J**  
Firm: **RKK**

**Location** Address: **5900 LAKE AVE** Cross Street: **LAKEHURST DR**

**Manhole** Type: **Junction** Location: **Roadway** Ground Conditions: **Dry**  
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **The Drop ext. I9 pipe picture shows Channel deterioration.**

**Cover** Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)  
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**  
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **3** (in.)  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated  
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated  
Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel** Material: **Brick** ☐ Parged  
Shape: **Circular** Diameter: **42** (in.) Length: (in.)  
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**  
Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)  
Channel Exposure: **Fully Open** Junc Dist: **0.5** nearest .5 ft. Azimuth: **260**  
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

**Steps** Count: **10** Missing: **0** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S25II2004MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Corroded steps. Bench debris.

Defect



Frame leaks. Adjustment, Corbel and Barrel infiltration.

Defect



Barrel deterioration and infiltration.

Defect



Frame leaks. Adjustment, Corbel and Barrel infiltration - other side.

## Manhole Inspection Summary

Manhole # S25II2004MH

Printed On: 12/17/2008

Page 3 of 4

### 10 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **16.08** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**


Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 10 in. Circular Gravity Sewer Pipe In @ 6 O'Clock

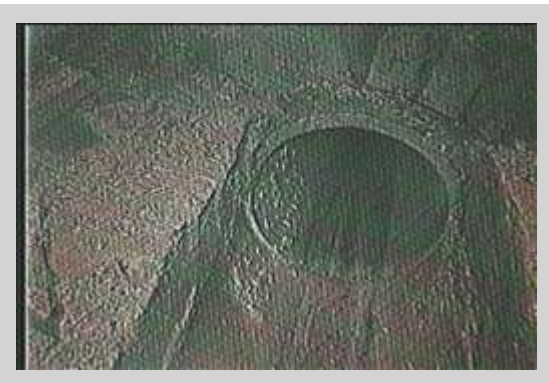

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **16.03** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S25II2004MH

Printed On: 12/17/2008

Page 4 of 4

## 8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Drop In @ 9 O'Clock



Barrel deterioration and infiltration. Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.83** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **14.37** (ft.)

Inv Depth: **15.37** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection